


OKLAHOMA CERTIFIED CORNER RECORD

X Existing _____ Obliterated _____ Lost

C.M. Document No. _____

WE 1/64 Corner of Section 28 Township 2 North Range 11 West

Meridian I.M. County Comanche

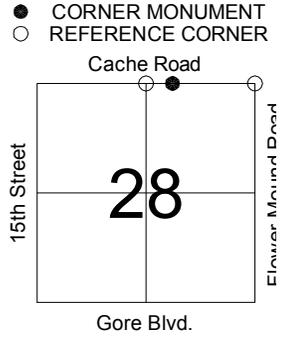

DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND ANY SUBSEQUENT RESTORATION: (Give Sources of Information)

Department of Libraries GLO Notes.

Not Set on Original Survey.

BLM Dependent Resurvey 1988.

From the Cor of Secs. 21, 22, 27 and 28. N 89°47' W bet. secs. 21 and 28.

19.965 chains (1317.69' appx.) Point for E 1/16 sec cor of secs 21 and 28. (Not Monumented).

29.950 chains (1976.70' appx.) The W-E 1/64 sec. cor. of secs. 21 and 28, monumented with a railroad spike firmly set flush with the road surface, origin and date unknown. This position has been locally recongized and is accepted as a careful and faithful determination of the cor. position.

At the Corner point

Drive a rebar, 5/8 in. diam., 15 ins. long, with an aluminum cap, 2 ins diam., 2 ins. below the road surface, with cap marked.


From Which:

A 16d Nail in lone wood post bears N 11° E, a distance of 42 lks (27.72' appx).

MONUMENT DESCRIPTION:

Description of Corner Evidence Found:

Found BLM Cap dated 1988

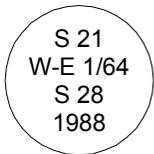

Face of a metal post corner of fences, 6 ins diam., lines extending N. and E., bears N 52° E a distance of 81 1/2 lks (53.79' appx).

Center of SSMH bears S 62° E, a distance of 55 lks (36.30' appx).

Coordinates established using classical static GPS, minimum two independent vectors

Included in the HPGN adjustment of 1993

Description of Corner Evidence Set:

None


REFERENCE MEASURMENTS: (At Least Three)

Description:	Distance	Bearing
	Feet	True <input type="checkbox"/> Magnetic <input checked="" type="checkbox"/>
RP # 1 16d Nail in Post	27.72'	N 11° E
RP # 2 Face 6" metal fence corner post	53.79'	N 52° E
RP # 3 Center SSMH	36.30'	S 62° E

SC #	Corner:	Found	Ground Dist.:	Grid Dist.:	Grid Bearing:
SC # 1	N 1/4 Corner:	Found ODOT Brass Cap C-16-232	658.99'	658.91'	N 89°33'34" W
SC # 2	NE Corner:	Found Steel Bar	1975.34'	1975.12'	S 89°34'23" E
SC # 3	NWSE 1/64 Corner:	Found BLM Cap	1978.44'	1978.22'	N 00°01'02" E

STATEMENT OF METHOD USED TO DETERMINE CORNER LOCATION: (Lost Corners Only)

SKETCH:

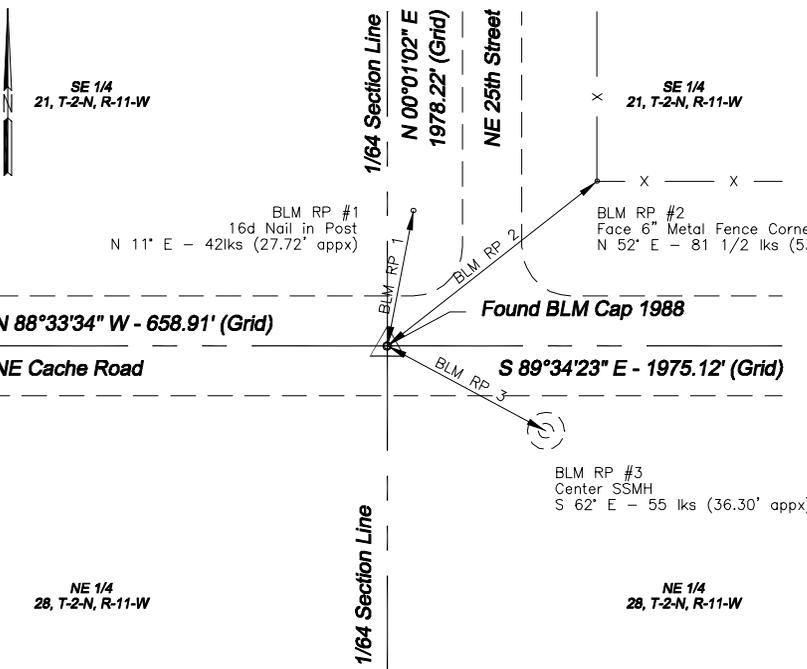

SURVEYOR'S CERTIFICATION: This is to certify that the monuments and accessories indicated above are correctly described and shown. I further certify that the corner records were checked for any filings prior to making this survey.

Signature: Edward Deral Paulk Jr., PLS 1279
 City Of Lawton, Engineering Department
 Firm _____ Phone Number _____
 103 SW 4th Street (580) 581-3318
 Street Address/Post Office Box _____ Web Site _____
 Lawton, Oklahoma 73501 www.cityof.lawton.ok.us/engineering
 City, State and Zip Code _____
 22 August 2003 P.L.S. 1279
 Date and Registration Number _____


OKLAHOMA STATE PLANE COORDINATES: NAD 1983 (ADJ 1993 HARN)
 Coordinates are in US Survey Feet.

X: E 1860532.328 Y: N 469607.859 ZONE: SOUTH

Accepted and Filed: _____

Archivist, Archives & Records Division
 Oklahoma Department of Libraries
 200 Northeast 18th Street
 Oklahoma City, Oklahoma 73105

Date: _____

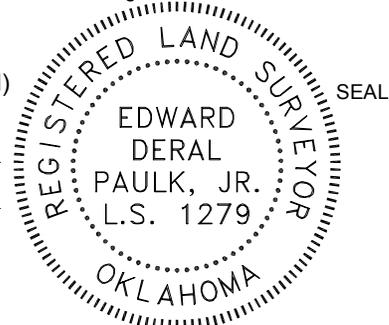

File Name: 23BLM1.dwg